



GTEC UPS MODEL:

MUST30-120

Setup Name Procedure

SERVICE DOCUMENT

MUST UPS SETUP NAME Procedure

Use Hyper terminal and give an operation process,as follow:

1、 setup connection



2.setup com port

Select your COM number



3、port setting


Bit: 2400

Bit data: 8


Parity: None

Bit stop: 1


Control: None

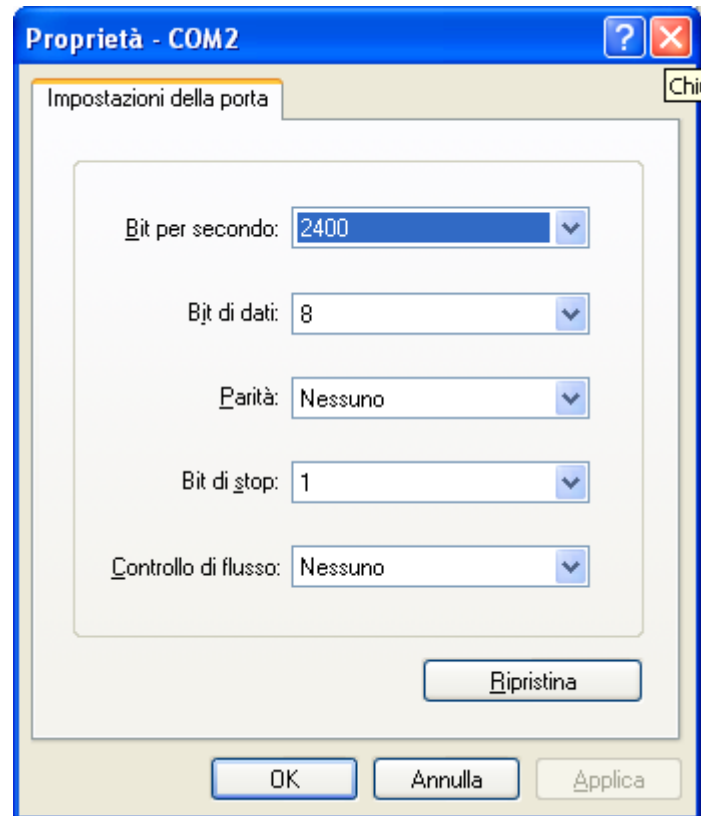


Press OK, then select Property

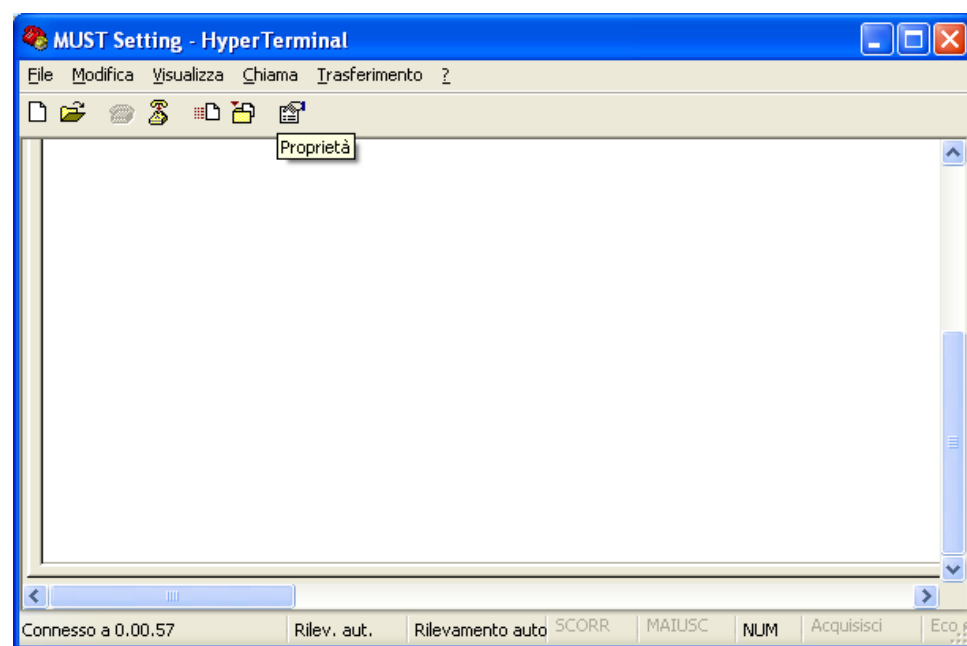

Select setting,

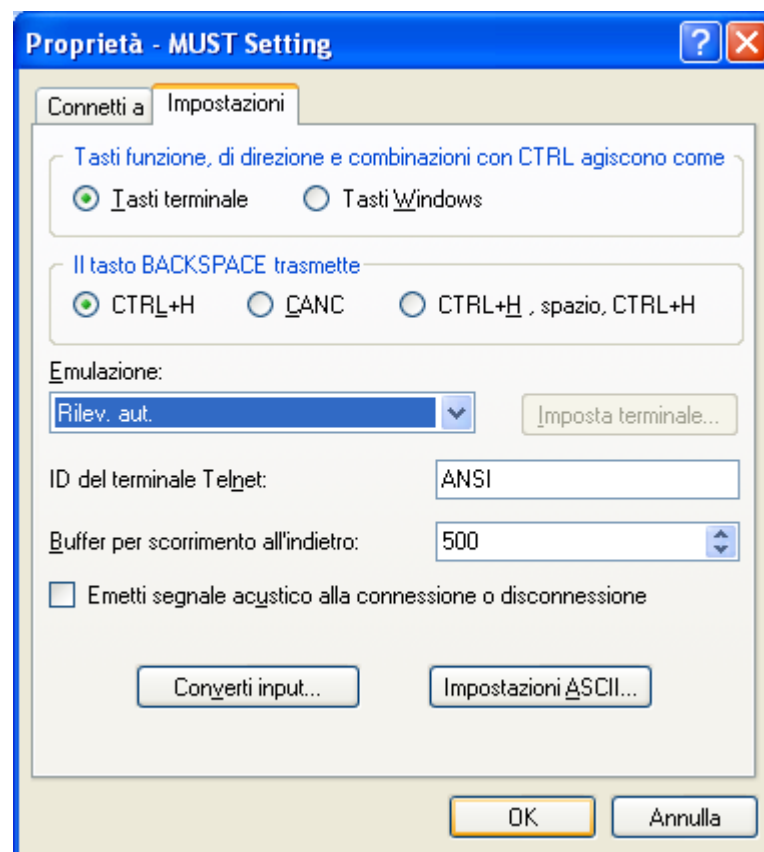

Select ASCII setting, set as on picture

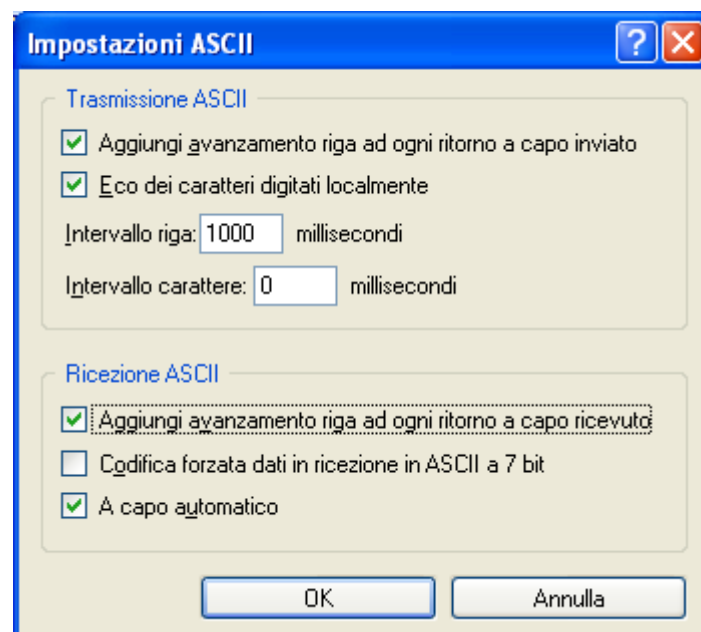

4、setup name

Setup ups name use two instruction: ZUxxxx+CR, ZIxxxxxxx+CR

When we will setup name, send ZU instruction unlock at first, then send ZI instruction setup name.

ZUxxxx+CR:

time information:

X	X	X	X:
(UPSTYear+1)%10)	(UPSTMonth+9)%10)	(UPSTDay+1)%10)	(UPSTHour+2)%10)

For example, now UPS time is 2009-7-24 10: 33

(2009+1) = 2010, use 0

(09+9) = 18 use 8

(15+1) = 16 = 6

(11+2) = 13 use 3

Send instruction: ZU0893+CR, UPS return Done, then setup ups name like MUST, UPS return Done, setup complete.

If we want to erase UPS name, send instruction: ZI +CR

